

# SERVICE BULLETIN

## Wheel Spacers

Model #: All

Date: 4/1/2008

**AFFECTED TRUCKS:** All

**SERVICE PROCEDURE:**

The Taylor-Dunn rear 6" disc brake caliper and the Dana transmission brake drum are only slightly smaller than the wheel. There are aftermarket wheels that will make contact with the brake caliper or drum.


Two wheel spacers are available (4-hole and 5-hole patterns) that should eliminate the contact issue. Use only one spacer per wheel. If more than one spacer is required then the wheel is not compatible with a Taylor-Dunn vehicle.

If a spacer is installed on the left front or rear axle, then a spacer should be installed on the opposing right front or rear axle even if it is not required for wheel clearance.

Refer to the vehicle service manual for details regarding removal and installation of the wheels.

PARTS REQUIRED		
Part number	Description	QTY
16-051-00	Spacer, 5-hole pattern	2
16-052-00	Spacer, 4-hole pattern	2

**WARRANTY INFORMATION:** No warranty allowance.

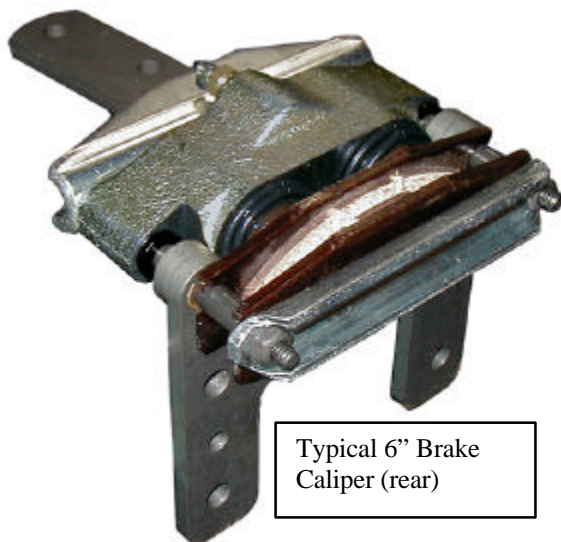

Typical 6" Brake Caliper (rear)



**WARNING:**

Do not install more than one wheel spacer on a wheel. Installation of more than one spacer on a wheel may result in on or more of the following:

- Loosening of the wheel nuts
- Damage to the wheel
- Damage to the wheel studs
- Wheel falling off o the vehicle

The occurrence of any one of the above may result in loss of control of the vehicle and severed bodily injury.